



Belling / Stoves Gas Hobs	
Aspect	Details
Alert Number	2304-0135
Product Type	Gas appliances and components – Gas hob (gas supply elbow joint)
Product Identifiers	The list of affected models is attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Type	Poisoning, burns or gas explosion and/or fire
Risk Level	Serious
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk. The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	<p>A replacement gas supply pipe elbow has been identified and a modification programme is being implemented to replace the elbow pipe in all appliances on-site for models listed in Annex 1.</p> <p>All owners of one of the affected models must:</p> <ol style="list-style-type: none">1. Isolate the gas supply to the hob or caravan / holiday home immediately, by turning off the isolation valve to the hob, or to the holiday home or caravan.2. Contact Belling to arrange a free of charge modification via:<ol style="list-style-type: none">a. Email: contactus@belling.co.ukb. Tel: 034 3212 1088 <p>Further information is also available in the Safety Notice on the Belling website at: https://www.belling.co.uk/en-gb/safety-notice</p> <p>OPSS have issued suspension notices requiring manufacturers to stop the supply of models of gas hobs with certain elbow joints listed in Annex 1 and Annex 2.</p>
Online Marketplace	N/A
Notifier	Local Authority Trading Standards / Office for Product Safety and Standards




Annex 1 - List of affected models subject to existing modification programme

444410131	BEL GHU602GC Sta
444410132	BEL GTG60C Blk
444410133	BEL GHU75C Sta
444410134	BEL GTG75C Blk
444410193	ST GTG60C Blk
444410443	BEL GHU602C LPG Sta
444410444	BEL GTG600C LPG Blk
444410446	BEL GHU75C LPG Sta
444410447	BEL GTG75C LPG Blk
444411638	BEL GHU753RI STA

Images of affected models subject to existing modification programme



444410131 BEL GHU602GC Sta

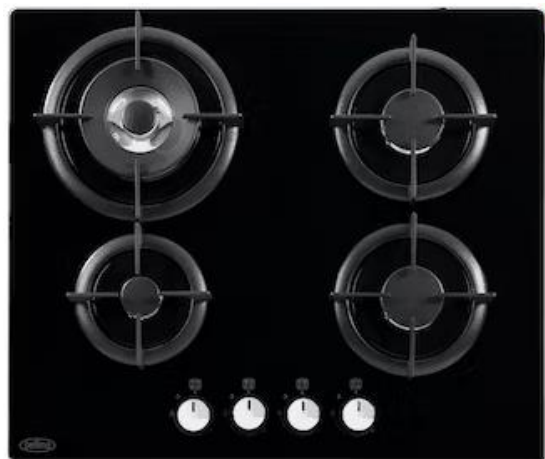

444410132 BEL GTG60C Blk



Office for Product
Safety & Standards

Product Safety Report




444411638 BEL GHU753RI STA



444410133 BEL GHU75C Sta




444410134 BEL GTG75C BIK

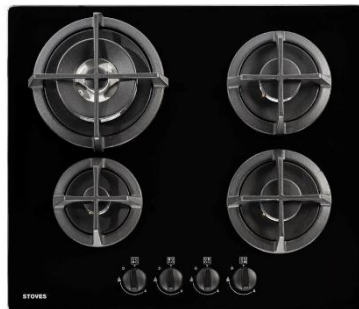

444410193 ST GTG60C BIK




444410443 BEL GHU602C LPG Sta

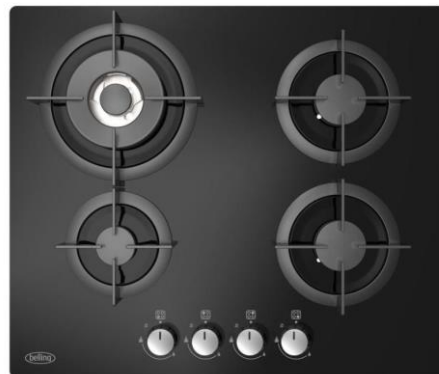

444410444 BEL GTG600C LPG BIK



444410446 BEL GHU75C LPG Sta

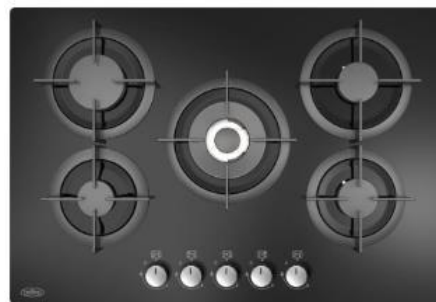

444410447 BEL GTG75C LPG BIK

The OPSS Product Safety Alerts, Reports and Recalls Site can be accessed at the following link: <https://www.gov.uk/guidance/product-recalls-and-alerts>



Product Safety Report

Annex 2 – List of affected models subject to suspension notice by the Office for Product Safety and Standards [Added 06/07/2023]


PSD Reference Number	Brand Name	Model Number	Image
2307-0035	Stoves	444410191	
2307-0037	Stoves	444410194	
2307-0057	Stoves	444410196	
2307-0058	Belling	444411635	
2307-0060	Belling	444411636	



Product Safety Report

2307-0061	Belling	444411637	
2307-0062	Belling	444411639	
2307-0063	Belling	444411640	




Cooke & Lewis Gas Hob	
Aspect	Details
Images	
Alert Number	2306-0153
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	Brand: COOKE & LEWIS Model Number: CLGH65ALL
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire
Risk Description	The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk. The products are not in conformity with the requirements of Regulation 2016/426.
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards



Cata/Culina Gas Hobs	
Aspect	Details
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	List of affected models attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire.
Risk Description	The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk. The products are not in conformity with the requirements of Regulation 2016/426.
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards


List of Affected Models

PSD Reference Number	Brand Name	Model Number	Image
2307-0015	Culina/Cata	UBGHC601S	



Office for Product
Safety & Standards

Product Safety Report

2307-0016	Culina/Cata	UBGHC701S	
-----------	-------------	-----------	--






Caple Gas Hobs	
Aspect	Details
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	List of affected models attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire.
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk.</p> <p>The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards

List of Affected Model Numbers

PSD Reference Number	Model Numbers	Image
-----------------------------	----------------------	--------------



Product Safety Report

2307-0049	C749G	
2307-0051	C750G	
2307-0052	C767G	
2307-0053	C768G	
2307-0055	C774G	



Office for Product
Safety & Standards

Product Safety Report

2307-0056

C775G





Cookology Gas Hobs	
Aspect	Details
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	List of affected models attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire.
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk.</p> <p>The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards










Product Safety Report

List of Affected Model Numbers

PSD Reference Number	Model Numbers	Image
2306-0161	GGH300BK	
2306-0162	GGH305BK	
2306-0163	GGH600BK	
2306-0164	GGH600WH	








Product Safety Report

2306-0165	GGH605BK	
2306-0166	GGH605WH	
2306-0167	GGH609BK	
2306-0170	GGH755BK	 
2306-0171	GGH905BK	 


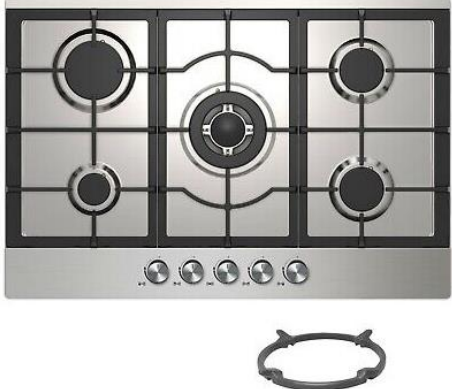




Product Safety Report

2306-0173	GH600SS	
2306-0174	GH601BK	
2306-0175	GH601WH	
2306-0176	GH605SS	
2306-0177	GH609SS	




Product Safety Report

2306-0178	GH750SS	
2306-0179	GH755SS	
2306-0180	GH900SS	
2306-0181	GH905SS	




Electriq Gas Hobs	
Aspect	Details
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	List of affected models is attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire.
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk.</p> <p>The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards

List of Affected Model Numbers

PSD Reference Number	Model Numbers	Image
2306-0154	IQGH603S	



Kitchenplus Gas Hob	
Aspect	Details
Images	
Alert Number	2306-0182
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	Model Number: KP60
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire.
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk.</p> <p>The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards



Product Safety Report

2306-0155	IQGH604B	
2306-0156	IQGH604W	
2306-0157	IQGH75BG	
2306-0158	IQGH75S	
2306-0159	IQGH75WG	



Office for Product
Safety & Standards

Product Safety Report

2306-0160

IQGHVOL





Russell Hobbs Gas Hobs	
Aspect	Details
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	List of affected models attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire.
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk.</p> <p>The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards






List of Affected Model Numbers

PSD Reference Number	Model Numbers	Image
2307-0001	RH60GH402B	

The OPSS Product Safety Alerts, Reports and Recalls Site can be accessed at the following link: <https://www.gov.uk/guidance/product-recalls-and-alerts>

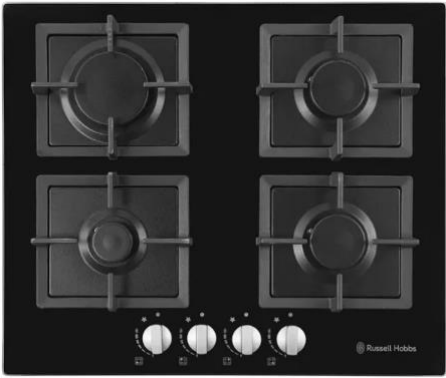

Product Safety Report

2307-0002	RH60GH402B/01	
2307-0003	RH60GH402SS	
2307-0004	RH60GH402SS/01	
2307-0005	RH60GH403B	
2307-0006	RH60GH403DS	



Product Safety Report

2307-0007	RH60GH403DS/01	
2307-0009	RH60GH403SS	
2307-0010	RH60GH403SS/01	
2307-0011	RH75GH601B	
2307-0013	RH75GH601B/01	








Product Safety Report

2307-0014	RH75GH601SS	
2307-0019	RH75GH601SS/01	
2307-0020	RH75GH602B	
2307-0021	RH75GH602DS	
2307-0022	RH75GH602SS	



Product Safety Report

2307-0023	RH75GH602SS/01	
2307-0024	RH86GH701B	
2307-0025	RH86GH701B/01	
2307-0026	RH86GH701SS	
2307-0027	RH86GH701SS/01	




Product Safety Report

2307-0029	RH86GH702B	
2307-0030	RH86GH702DS	
2307-0033	RH86GH702SS	
2307-0034	RH86GH702SS/01	



Statesman Gas Hobs	
Aspect	Details
Product Type	Gas appliances and components – Gas Hob
Product Identifiers	List of affected models attached below.
Product Description	Gas hob supplied with elbow joint on the connecting pipework.
Country of Origin	China
Counterfeit	No
Risk Level	Serious
Risk Type	Poisoning, burns or gas explosion and/or fire
Risk Description	<p>The elbow on the connecting pipework of affected gas hobs can fail resulting in a significant gas leak, regardless of whether the hob is switched on and in use. Hazards resulting from a gas leak include burns, fire and explosion and poisoning from inhalation. The risk levels vary from low risk to serious risk, with the risk presented from fire and explosion being the worst case. The risk of fire and explosion in traditional built residences is high risk, and the risk of fire and explosion in a caravan or leisure homes is serious risk.</p> <p>The products are not in conformity with the requirements of Regulation 2016/426.</p>
Corrective Measures	OPSS have issued suspension notices requiring manufacturers to stop the supply of specified models of gas hobs with certain elbow joints.
Online Marketplace	N/A
Notifier	Office for Product Safety and Standards

List of Affected Model Numbers

PSD Reference Number	Model Numbers	Image
2307-0041	GH60GB	



Product Safety Report

2307-0042	GH60WH	
2307-0043	GH61SS	
2307-0044	GH75GB	
2307-0045	GH75SS	